## **Hazardous Walking Conditions**

2018-19 Site Review in Accordance with Section 1006.23 FS FDOE Station ID: 110037



#### **Prepared for:**

Florida Department of Transportation Lake-Sumter MPO Lake County Sheriff's Office


#### **Prepared by:**

William C. "Will" Davis, GISP Manager, Geographic Information Systems




**August 21, 2018** 

## FDOT HWC# 110037

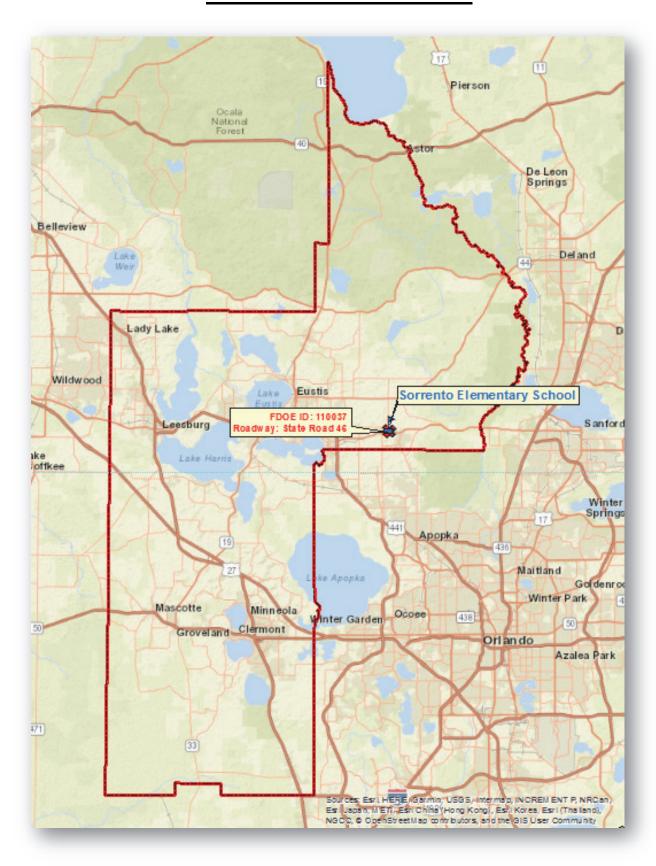


## **General Overview**

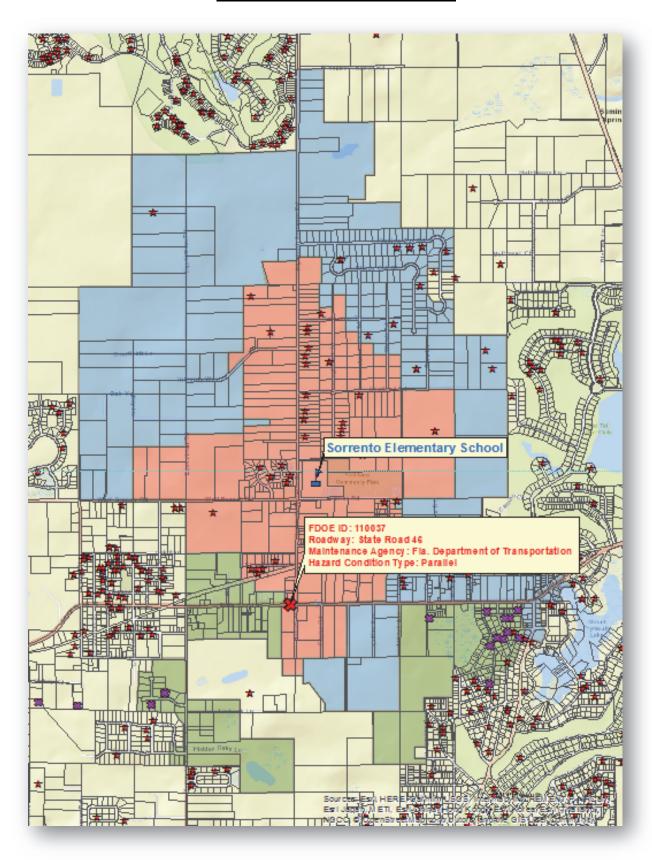

## **Detailed Hazardous View**



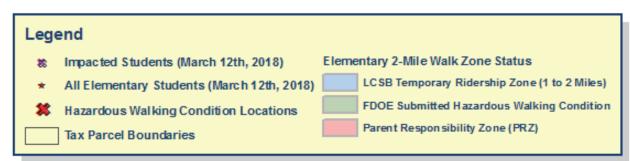



### FLORIDA DEPARTMENT OF Hazardous Walking Site Review Checklist

(To assist in determining eligibility for school transportation based on hazardous walking conditions in accordance with section 1006.23, Florida Statutes)

### Wallyways Darallal To The Boad

<u>YES</u>	<u>NO</u>	walkways Parallel 10 The Road
	_X_	1. Is the location in a residential area with little or no traffic? Is the location in a residential area and on a road or street that is not used as a major artery or cut-through?
	<u>X</u>	2. Is the location on a road where the traffic volume is fewer than 180 vehicles per direction per hour at 6:00 am - 9:00 am and 2:00 pm - 4:00 pm? <b>Note:</b> If the traffic count during the times students must walk is <u>180 vehicles per hour or more, in either direction</u> , the answer to this question is "no."
	_X_	3. Is the area located in a residential area and on a road that has a posted speed limit of 30 miles per hour or less?
If the answ	ers to 1., 2. a	., 2. or 3. is "YES," the area does not qualify as a hazardous walking location. nd 3. are all "NO," continue to next question.
If the poste	d speed limit	is less than 50 mph:
	X	4. Is there an area at least four feet wide with a "surface upon which students may walk" that prevents the students from having to walk on the road?  Note: The surface does not have to be a sidewalk, but simply a surface upon which the students may walk. Weeds, tall grass or flooding may be temporary maintenance problems that do not constitute a hazardous walking area. A walking surface does not include drainage ditches, sluiceways, swales or channels. A paved area contiguous with the paved roadway or extended shoulder (also known as a "breakdown lane"), with no separation from the driving area or raised curb, is not a walkway.
If the poste	d speed limit	is 50 mph or greater:
<u>N/A</u>	N/A	5. Is the road uncurbed with a four-foot wide walking surface (as defined in 4. above) separated from the road by an additional three or more feet?
N/A	<u>N/A</u>	6. Is the road curbed with at least a four-foot wide walking surface (as defined in 4. above)?

If the answer to 4., 5. or 6. is "YES," the area does not qualify as a hazardous walking location.

Location Code: 110037 Page 1 of 10

### **Walkways Crossing Over The Road**

(When students must cross the road)

A. For an "uncontrolled crossing site" (no crossing guard, traffic enforcement officer, stop sign or other

traffic control signal present during student walk times):										
<u>YES</u>	<u>NO</u>									
<u>N/A</u>	<u>N/A</u>	1. Does the traffic volume exceed 360 vehicles per direction, per hour (either direction, including all lanes in each direction)?								
N/A	N/A	2. Does the road have a posted speed limit of 50 MPH or greater?								
<u>N/A</u>	N/A	3. Does the road have six or more lanes (not including turning lanes)?								
		questions are "NO," the area does not qualify as a hazardous walking location above questions is "YES," the area would qualify as a hazardous walking	1.							
B. For an intersection or crossing site controlled by a stop sign or other traffic control signal, <u>but without</u> crossing guards or traffic enforcement officers during the times students must walk:										
_N/A_	N/A	<ol> <li>Does the total traffic volume (total of both directions) exceed 4,000 vehicle per hour?</li> </ol>	es							
If the answ	ver is "NO," the	rea does not qualify as a hazardous walking location.								
-		r crossing site with a crossing guard or other traffic enforcement officer cardous walking location, regardless of the posted speed limit.								
D. Comments/Notes/Diagrams:										
See at	tached mater	\$.								

Page 2 of 3

Location Code: \_\_\_\_\_110037

### **Hazardous Walking Site Review - Documentation and Authorization**

School District:		Lake		Site Revie	w Date:	7/25/2018				
Hazard Location:	SR 46 appro	ox. ±170 ft West of	intersec	tion of CR-	437 in Sorrento	/Mt. Plymouth				
Hazard Location Is:	X Parallel	to the road	Traffic	Count:	507 VPH (n	VPH (morning)				
	Crossin	g over the road	Traffic	Count:						
Hazard Jurisdiction:	Municip	oal (Identify:		)	County	X State				
Permanent Hazard?	XYes	No If no,	anticipa	ited correcti	ion date:					
School District Representative: William C. Davis, GISP  Print Name Signature										
Email:	davisw@	Dlake.k12.fl.us			-6707					
Roadway Jurisdiction Representative: Chad T. Lingenfelter, AICP, PTP  Print Name Signature										
Agency/Entity	· Florida Depa		rtation	Title: Bicycle/Pedestrian Safety Pro. Spec						
	Chad.Lingen			352-943-5336						
Law Enforcement Rep										
Agonov/Entity	Lake Coun	ty Sheriff's Office		Sign Title:						
	Jeff.DeSant				ne: 352-606-9722					
Liliali.				riione						
Metropolitan Planning Organization Represe (If applicable)		Sign	ature							
Agency/Entity	:Lake	e-Sumter MPO		Title:	Interim Execu	tive Director				
Email:	mwoods@lal	kesumtermpo.com		Phone:	352-315-0 <sup>-</sup>	170				
Assigned FDOE Hazard	dous Walking D	_110037	Date Entered	d: <u>N/A</u>						
Staff assigning and en	Staff assigning and entering hazardous walking location into the database: William C. Davis									

Location Code: 110037 Page 3 of 10

COUNTY: 11 STATION: 1019

DESCRIPTION: ON SR-46, 0.351 MI. E OF CR-437 N (UCLP)

START DATE: 07/05/2017

START TIME: 0000

	 T.TME:													
		DIR	ECTION:	E			DIR	ECTION:	W		COMBINED			
ΓΙΜΕ 	1ST 	2ND	3RD	4TH 	TOTAL	1ST	2ND 	3RD 	4TH	TOTAL	TOTAL  133 51 54 57 103 384 810 1144 997 946 892 911 969			
0000	21	10	18	9	58	18	23	15	19	75	133			
0100	7	4	3	11	25	9	5	8	4	26	51			
0200	4	2	5	10	21	9	9	8	7	33	54			
0300 0400	9 11	3 Q	8 22	1 Q	28 60	6   7	7	1 5	10 15	∠9 43	103			
0500	47	58	70	58	233	18	29	47	57	151	384			
0600	82	102	128	122	434	69	64	124	119	376	810			
0700	124	172	159	133	588	121	136	173	126	556	1144			
0800	132	135	135	105	507	117	120	135	118	490	997			
0900	141	141	121	93	496	107	122	106	115	450	946			
1000 1100	121 122	135 124	103 107	115 121	4/4	105	108	100	105 102	418 427	892			
1200	150	109	123	128	510	115	128	112	103	459	969			
1300	109	126	121	99	455	98	105	125	102	430	885			
1400	96	134	136	119	485	105	113	122	141	481	966			
1500	126	148	128	142	544	136	138	137	154	565	1109			
1600	157	145	137	179	618	193	148	199	172	712	1330			
1/00 1000	181	16/ 125	1/1 101	161 104	68U 404	195 154	170 120	1/8 157	192 110	/35	1415			
1900	74	93	80	67	314	105	88	87	60	340	654			
2000	$7\overline{4}$	55	78	62	269	82	43	95	54	274	543			
2100	61	63	46	39	209	61	48	42	43	194	403			
2200	46	38	28	25	137	39	40	32	29	140	277			
2300 	19 	20	18	13 	70	18	26 	30 	23	97 	997 946 892 911 969 885 966 1109 1330 1415 1053 654 543 403 277 167			
				P	EAK VOLU	JME INFO	RMATION W LUME 556 736							
	DI	RECTION	E		DIF	RECTION:	W	C	OMBINE	DIRECT	CIONS			
70 10/1	HOUR	. V(	OLUME		HOUR	VO:	LUME		HOUR	VOL	UME			
A.M. DM	715 1645		596 698		1630		736		715 1700	1 1	.148 .415			
DAILY	1645		698		1630		736		1700	1	415			
TRUCK I	PERCENT	AGE 9	.02			9.	14			9.0	8			
				CLAS	SIFICAT	ON SUMM	ARY DATA	BASE						
DIR :	1 2	3	4	5	6	7 8	9	10	11	12	13 14 3 0 0 0	15	TOTTRK	TOTV
E :	19 548	1 1953	45	422	55 65	18 5	3 134	9	0	0	3 0	1	739	81
VV .	∠∪ 529	/ 2000	39	434	CO	10 5	± 1∠8	0	Т	U	0 0	U	131	81

GENERATED BY SPS 5.0.53P

## **FDOE HWC# 110037**



# Hazardous Walking Condition ID: 110037 Field Inspection Photos



Photo No. 2: Date & Time: 2018:07:18 14:32:15 / Photo Direction of View: 262°



<u>Photo No. 3:</u> Date & Time: 2018:07:18 14:32:35 / Photo Direction of View:  $269^{\circ}$ 

## Hazardous Walking Condition ID: 110037 Field Inspection Photos -- Continued



Photo No. 4: Date & Time: 2018:07:18 14:33:16 / Photo Direction of View: 89°



Photo No. 5: Date & Time: 2018:07:18 14:33:33 / Photo Direction of View: 89°

# Hazardous Walking Condition ID: 110037 Field Inspection Photos -- Continued



 $\underline{Photo~No.~6:}~Date~\&~Time:~2018:07:18~14:34:39~/~Photo~Direction~of~View:~81°$ 

## **FDOE HWC# 110037**



# Hazardous Walking Condition ID: 110037 Field Inspection Photos



Photo No. 2: Photo Direction of View: 257°



Photo No. 3: Photo Direction of View: 264°

## <u>Hazardous Walking Condition ID: 110037</u> <u>Field Inspection Photos -- (Continued)</u>



Photo No. 4: Photo Direction of View: 111°



Photo No. 5: Photo Direction of View: 102°